



RoHS III
COMPLIANT

UK
CA
EAC



Data sheet

DA09 (ATEX)

Differential pressure measuring unit
Pressure levels PN10/PN25

Diaphragm manometer
for use in explosive areas


CrNi-steel model

DA09... 0A

DA09... 1B

DA09... 1C

DA09... 2D

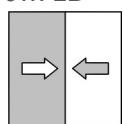

1 Product and functional description

1.1 Performance features

Areas of application

- Chemical, petrochemical industry
- Process technology
- Marine and offshore technology
- Power plant technology
- Mechanical and plant engineering

Important features

- Highly corrosion resistant
- CrNi-steel model
- Use with aggressive media
- Highly durable
- Variable connection technology
- With fluid filling as an option
- Optional additional equipment such as contact element or rotation angle encoder

1.2 Function diagram

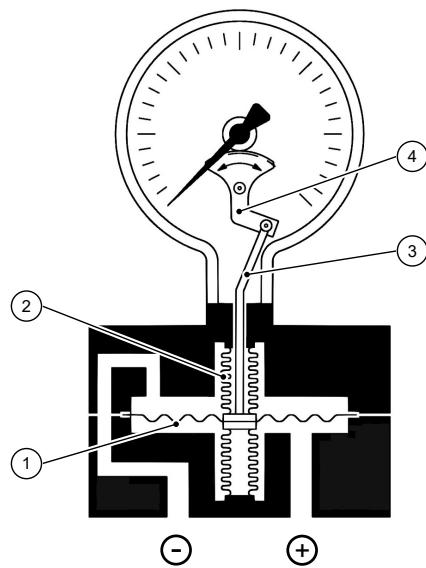


Fig. 1: Function diagram

1 Measuring diaphragm	2 Bellows
3 Tie rod	4 Motion train

1.3 Design and mode of operation

The measuring system comprises a diaphragm and two separate pressure chambers. Differential pressure between the chambers causes axial movement of the diaphragms. A tie rod transfers this movement to an indicator.

The seal between the pressure chamber and tie rod is realised with metal bellows. To compensate the static operating pressure, the measuring system is symmetrical.

1.4 Equipment versions

The illustrations are just examples. The equipment features can be combined according to the order code.

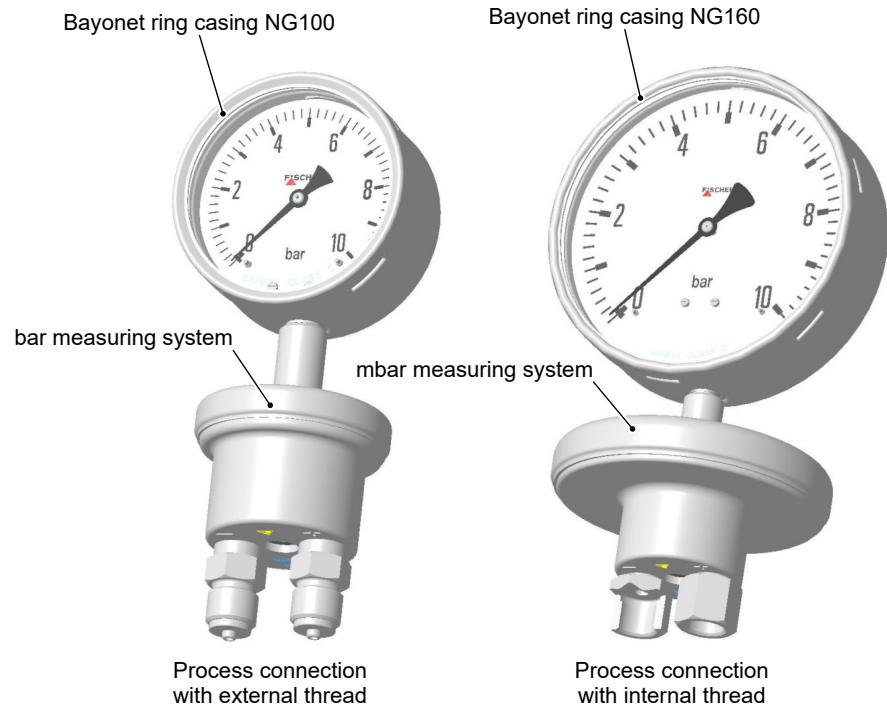


Fig. 2: Equipment versions NG100, NG160

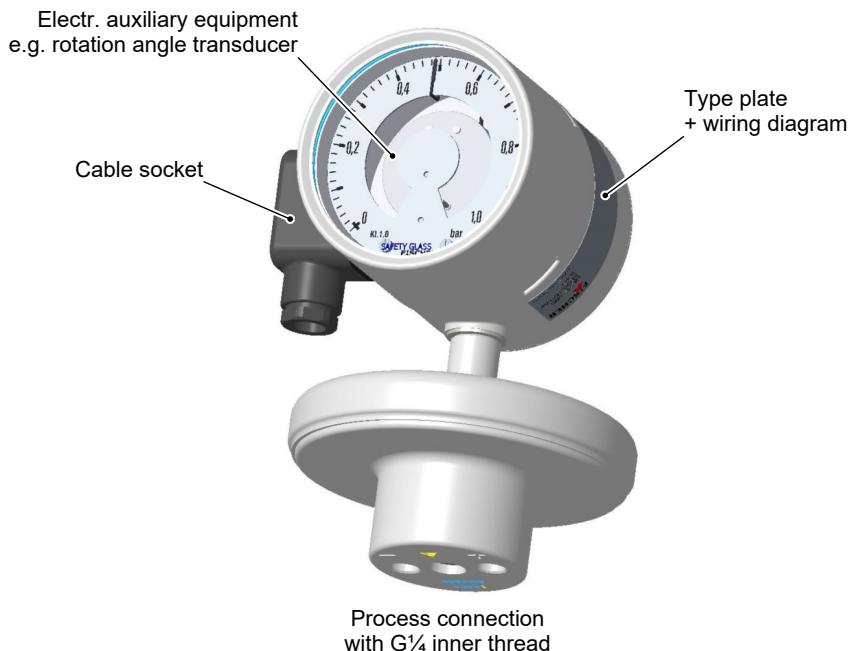


Fig. 3: Equipment versions additional equipment

2 Technical Data

2.1 General

Please also observe the order code here.

2.2 Input variables

Measuring variable

Absolute pressure for gaseous, fluid and aggressive media.

Measuring ranges [bar, mbar]

Measuring range	PN	Measuring range	PN
0 ... 0.6 bar	<i>25 bar</i>	-1 ... 0.6 bar	<i>25 bar</i>
0 ... 1 bar	<i>25 bar</i>	-1 ... 1.5 bar	<i>25 bar</i>
0 ... 1.6 bar	<i>25 bar</i>	-1 ... 3 bar	<i>25 bar</i>
0 ... 2.5 bar	<i>25 bar</i>	-1 ... 5 bar	<i>25 bar</i>
0 ... 4 bar	<i>25 bar</i>		
0 ... 6 bar	<i>25 bar</i>		
0 ... 10 bar	<i>25 bar</i>		
0 ... 16 bar	<i>25 bar</i>		
0 ... 25 bar	<i>25 bar</i>		
0 ... 25 mbar	<i>10 bar</i>	-40 ... 60 mbar	<i>10 bar</i>
0 ... 40 mbar	<i>10 bar</i>	-60 ... 100 mbar	<i>10 bar</i>
0 ... 60 mbar	<i>10 bar</i>	-100 ... 150 mbar	<i>10 bar</i>
0 ... 100 mbar	<i>10 bar</i>	-150 ... 250 mbar	<i>25 bar</i>
0 ... 160 mbar	<i>10 bar</i>		
0 ... 250 mbar	<i>10 bar</i>		
0 ... 400 mbar	<i>25 bar</i>		
0 ... 600 mbar	<i>25 bar</i>		

Measuring ranges [kPa, PSI]

Measuring range	PN	Measuring range	PN
0 ... 2.5 kPa	<i>10 bar</i>	0 ... 3 PSI	<i>10 bar</i>
0 ... 4 kPa	<i>10 bar</i>	0 ... 5 PSI	<i>25 bar</i>
0 ... 6 kPa	<i>10 bar</i>	0 ... 10 PSI	<i>25 bar</i>
0 ... 10 kPa	<i>10 bar</i>	0 ... 15 PSI	<i>25 bar</i>
0 ... 16 kPa	<i>10 bar</i>	0 ... 30 PSI	<i>25 bar</i>
0 ... 25 kPa	<i>10 bar</i>	0 ... 60 PSI	<i>25 bar</i>
0 ... 40 kPa	<i>25 bar</i>	0 ... 100 PSI	<i>25 bar</i>
0 ... 60 kPa	<i>25 bar</i>	0 ... 250 PSI	<i>25 bar</i>
0 ... 100 kPa	<i>25 bar</i>	0 ... 300 PSI	<i>25 bar</i>
0 ... 160 kPa	<i>25 bar</i>		
0 ... 250 kPa	<i>25 bar</i>		
0 ... 400 kPa	<i>25 bar</i>		
0 ... 600 kPa	<i>25 bar</i>		

Pressure load

Idle load	Scale upper value
Alternating load	Scale upper value
Overload capability on one side (+) and (-)	10 x Scale upper value ≤ PN

2.3 Measurement accuracy

Accuracy class	1.6
Characteristic curve deviation	± 1.6 % of the measuring range (FS)
Temperature influence (Reference + 20°C)	± 0.8 %FS / 10K
Influence of static pressure for measuring ranges (MBR) < 250 mbar	≤ 0,1 % + $\frac{0,004 \%}{MBR [\text{bar}]}$
Influence of static pressure for measuring ranges (MBR) ≥ 250 mbar	≤ $\frac{0,1 \%}{\text{bar}}$

2.4 Operating conditions

Permissible ambient temperature	-20 ... +60 °C
Admissible storage temperature	-20 ... +80 °C
Admissible media temperature	≤ 100 °C
Type of protection	IP 66 acc. to EN 60529

2.5 Construction design

Materials

	Material	Material no.
Bayonet ring housing NG100, NG160	CrNi steel	1.4301, 1.4404
Safety housing	CrNi steel	1.4404
Process connection	CrNi steel	1.4404
Motion train	CrNi steel	
Dial face and needle	Aluminium, painted, printed	
Inspection disk	Safety laminated glass	

Parts in contact with the medium

	Material	Material no.
Pressure chamber	CrNi steel	1.4404
Diaphragm MB ≤ 160 mbar	CrNi steel	1.4571
Diaphragm MB ≥ 250 mbar and ≤ 6 bar	NiCrCo alloy	DURATHERM®
Diaphragm MB ≤ 10 bar	NiCr. alloy	INCONEL® 718
Bellows	NiCr. alloy	Alloy 625
Seal	Metal seal	

Process connection

	Material	Material no.
Connecting piece and port	CrNi steel	1.4404
Cutting ring screw connections	CrNi steel	1.4571

Electrical connection

In the case of devices with additional electronic equipment, the connection is realised using a cable socket attached to the side.

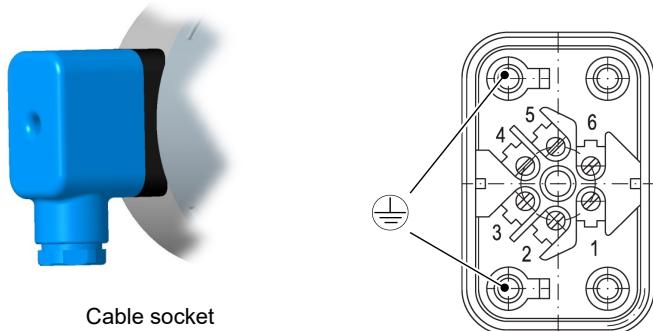


Fig. 4: Cable socket

Cable socket

Number of screw terminals	6 + 2PE
Rated current	See data sheet KE
Rated voltage	250 V
Conductor cross-section	up to 1.5 mm ² with wire protection
Cable gland	M20 x 1.5
Terminal range	7 ... 13 mm
Tightening torque	3 Nm
Key width	21

Assembly

Direct assembly	Mounted to the pipes
Wall mounting	Flanged assembly plate
Pipe mounting	Flanged assembly plate and attachment bracket
Mounting position	Vertical
Weight	Depending on the version 2,7 ... 7 kg

Additional Attachments

Contact elements

Limit signal transmitters (contacts) and capacitive rotation angle transducers with an output signal proportional to the angular position can be fitted into a housing augmented by a corresponding bayonet ring connector.

A certain minimum pressure level is required to operate this kind of contact element, which is why there is a lower limit for the mbar measuring ranges. This limit depends on the model type and is stated in the section 'General'.

The measuring deviation increases by $\pm 0.5\%$ per contact when the contacts are driven and switched.

For more information and the order key, please refer to the data sheet:

- for limit switch in data sheet KE
- for rotation angle converter in the data sheet KE09

Fluid charging

Under aggravated operating conditions, such as vibrations and extreme pressure fluctuations, or in order to avoid condensation forming if used outdoors, the casing can be filled with the following fluids depending on the type of contacts installed:

without contacts	Paraffin oil, glycerine, silicon oil
Low-action contacts	Paraffin oil, silicon oil
Magnetic spring contacts	Silicon oil
Inductive contacts	Paraffin oil, silicon oil
Rotation angle transducer	no filling possible

Marker needle

A settable red marker can be attached to the scale to clearly show a certain pressure (limit value).

Trailing needle

The trailing needle is 'dragged' with the measured value indicator. As there is no fixed connection between the two needles, one-off maximum values are stored. The trailing needle can be reset using an adjusting dial in the window. Trailing needles cannot be used in conjunction with contacts. A certain minimum pressure level is required to move the drag indicator, which is why there is a lower limit for the mbar measuring ranges. This limit depends on the model type and is stated in the section 'General'.

Shut-off fitting

Three-spindle equalisation and shut-off valve DZ93 or four-spindle equalisation and shut-off valve DZ94.

- Material 1.4404
- Functions: Shut-off, pressure compensation

2.6 Dimensional drawings

All dimensions in mm unless otherwise stated

2.6.1 Standard version

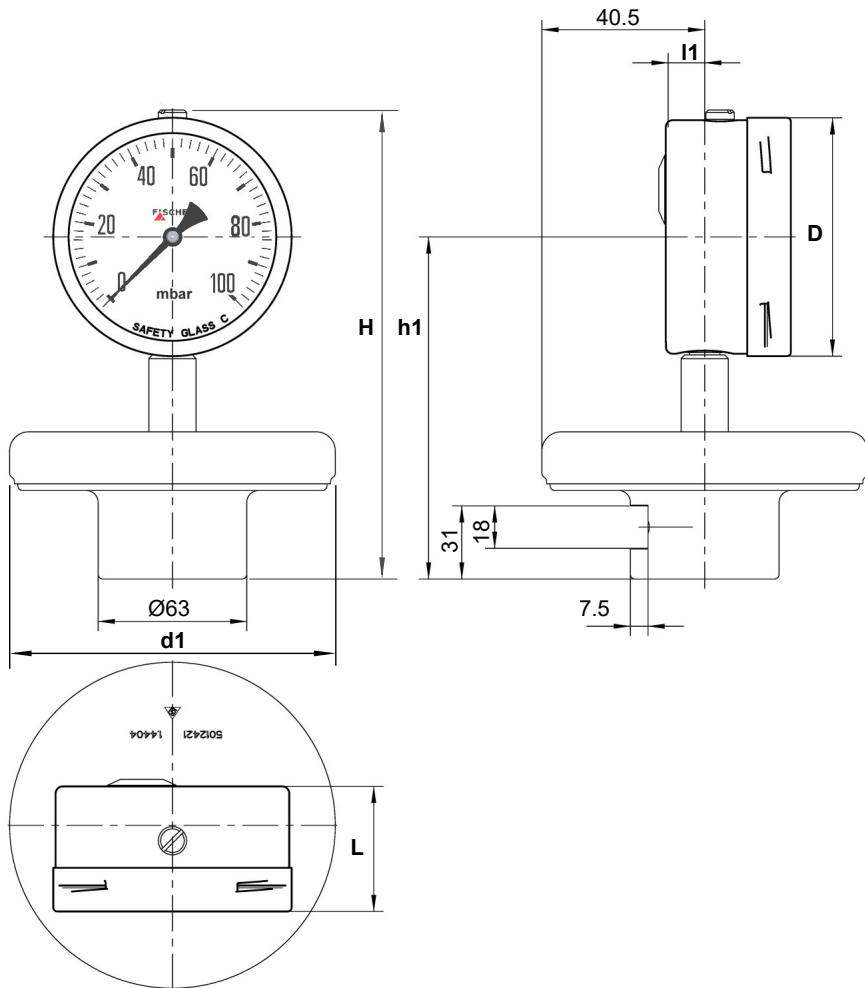


Fig. 5: Dimensional picture 25 ... 250 mbar

Measuring range 25...250 mbar


Housing	Tol.	D	d1	H	h1	L	I1
NG100	± 0.1	101	138	199	145	53	15.5
NG160	± 0.1	161	138	259	175	53.5	16.5

Measuring ranges 0.4 ... 25 bar

Housing	Tol.	D	d1	H	h1	L	I1
NG100	± 0.1	101	81	198	144	53	15.5
NG160	± 0.1	161	81	258	174	54.5	16.5



2.6.2 Tube and wall mounting

The dimensions stated apply for all housing models. The example shown is a bayonet ring housing NG160.

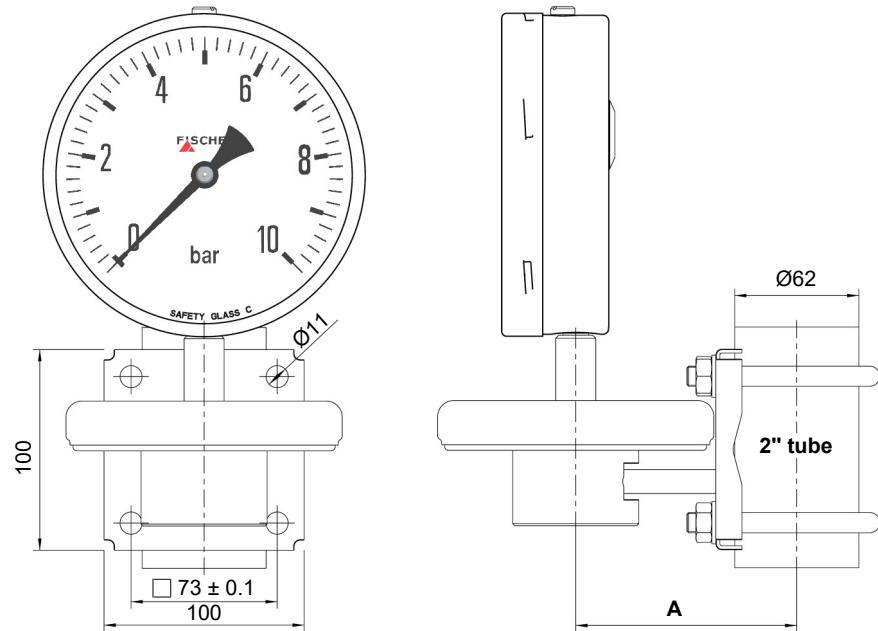

Tube assembly

Measuring range	Tol.	A	B
25 ... 250 mbar	± 0.1	110.4	83
0.4 ... 25 bar	± 0.1	54.5	81.9

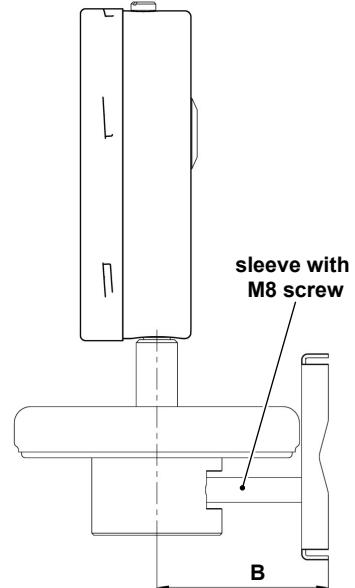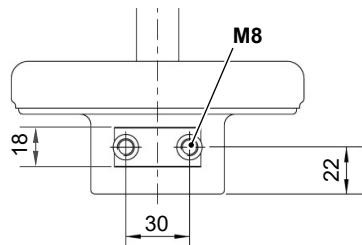

wall mounting

Fig. 6: Tube and wall mounting

2.6.3 Process connection

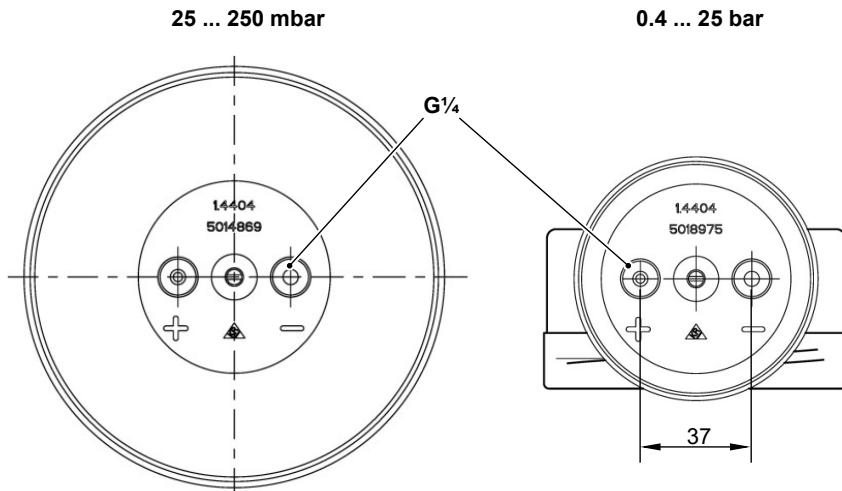


Fig. 7: Process connection

2.6.3.1 Connection port with cylindrical external thread

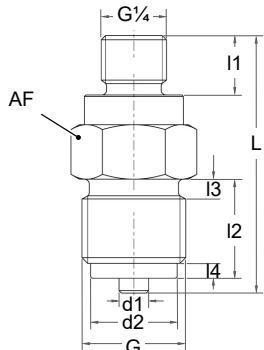


Fig. 8: Connecting port G

G	d1	d2	L	I1	I2	I3	I4	SW
Tol.	± 0.1	± 0.2	± 0.3	± 0.2	± 0.2	± 0.1	± 0.1	
G $\frac{1}{2}$	6	17.5	52	12	23	4	3	22
G $\frac{1}{4}$	5	9.5	39	12	15	3	2	19

SW:= Key width

2.6.3.2 Connection shanks with tapered external thread


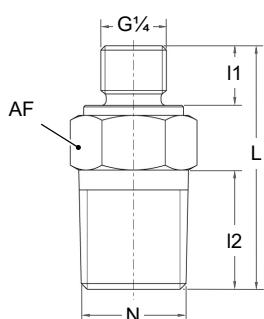


Fig. 9: Connecting port NPT

N	L	I1	I2	SW
Tol.	± 0.3	± 0.2	± 0.2	
1/2-14 NPT	49	12	24	22
1/4-18 NPT	42	12	18	19

SW:= Key width

2.6.3.3 Connecting port with inner thread

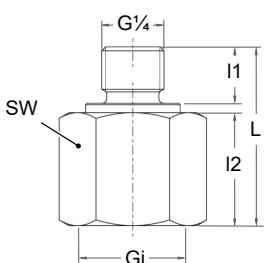

Gi	L	I1	I2	SW
Tol.	± 0.3	± 0.2	± 0.2	
G $\frac{1}{2}$	38	12	24	27
1/2-14 NPT	38	12	24	27
1/4-18 NPT	32	12	18	19

SW:= Key width

Fig. 10: Connecting port Gi

2.6.4 Additional Attachments

2.6.4.1 Safety model

The device can be supplied in a safety housing acc. to DIN 837 with an unbreakable partition wall and a rear wall that can be blown out (S3).

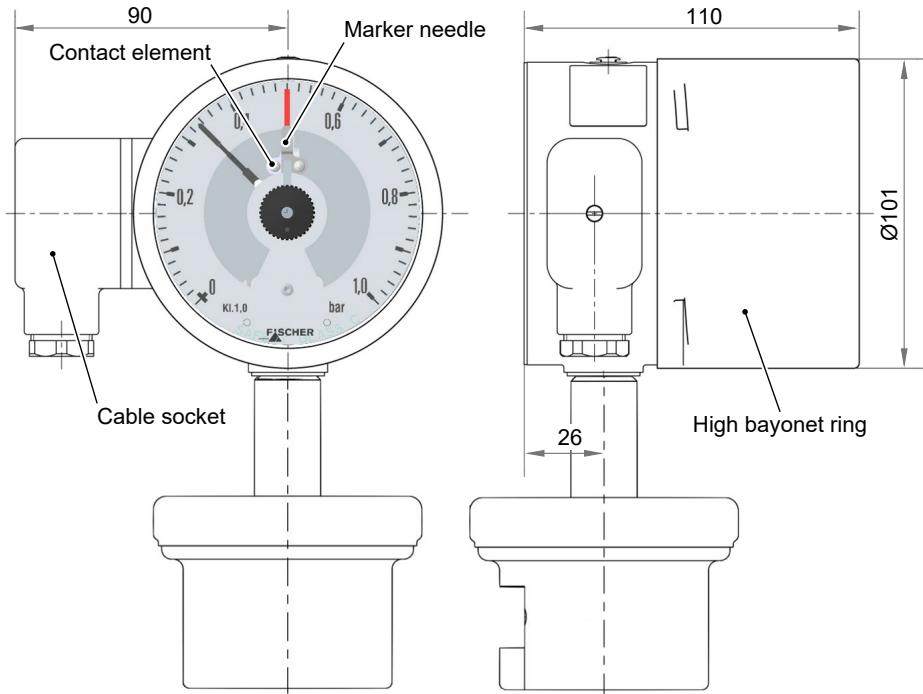


Fig. 11: Safety housing

2.6.4.2 Bayonet ring housing

Model with cable socket


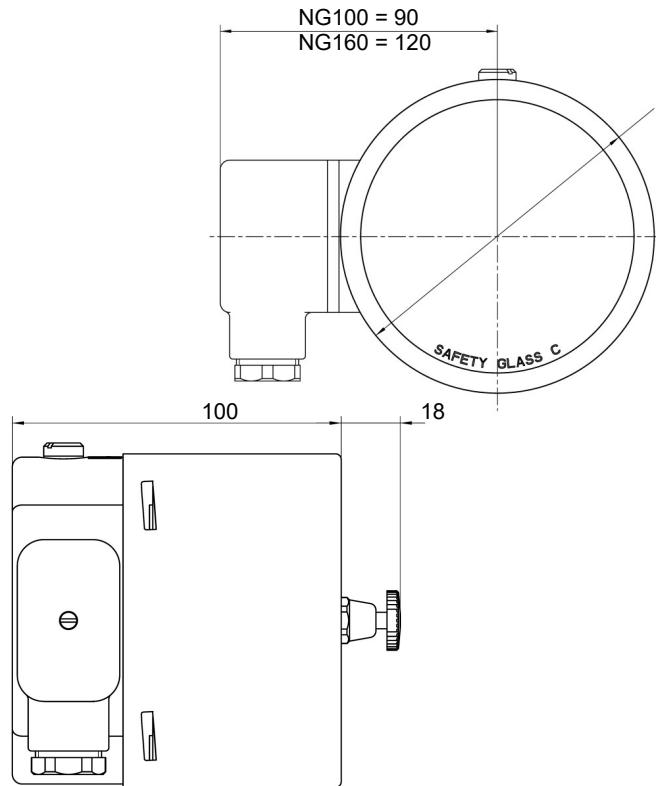


Fig. 12: Bayonet ring housing with cable socket

3 Order Codes

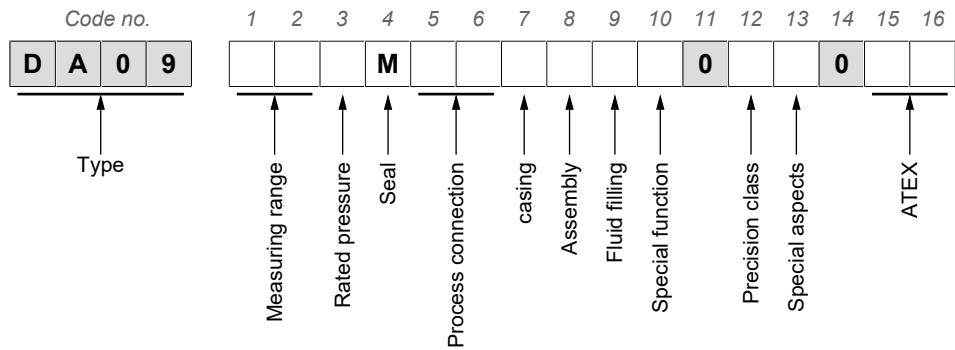

[1.2]	Measuring range	PN	[1.2]	Measuring range	PN
01	0 ... 0.6 bar	25 bar	32	-1 ... 0.6 bar	25 bar
02	0 ... 1 bar	25 bar	33	-1 ... 1.5 bar	25 bar
03	0 ... 1.6 bar	25 bar	34	-1 ... 3 bar	25 bar
04	0 ... 2.5 bar	25 bar	35	-1 ... 5 bar	25 bar
05	0 ... 4 bar	25 bar			
06	0 ... 6 bar	25 bar			
07	0 ... 10 bar	25 bar			
08	0 ... 16 bar	25 bar			
09	0 ... 25 bar	25 bar			
56	0 ... 25 mbar (180° scale)	10 bar	70	-40 ... 60 mbar	10 bar
57	0 ... 40 mbar	10 bar	72	-60 ... 100 mbar	10 bar
58	0 ... 60 mbar	10 bar	74	-100 ... 150 mbar	10 bar
59	0 ... 100 mbar	10 bar	76	-150 ... 250 mbar	25 bar
60	0 ... 160 mbar	10 bar			
82	0 ... 250 mbar	10 bar			
83	0 ... 400 mbar	25 bar			
C1	0 ... 600 mbar	25 bar			

[1.2]	Measuring range	PN	[1.2]	Measuring range	PN
N3	0 ... 2.5 kPa (180° scale)	10 bar	H1	0 ... 3 PSI	10 bar
N4	0 ... 4 kPa	10 bar	H2	0 ... 5 PSI	25 bar
N5	0 ... 6 kPa	10 bar	H3	0 ... 10 PSI	25 bar
E5	0 ... 10 kPa	10 bar	H4	0 ... 15 PSI	25 bar
E6	0 ... 16 kPa	10 bar	H5	0 ... 30 PSI	25 bar
E7	0 ... 25 kPa	10 bar	H6	0 ... 60 PSI	25 bar
E8	0 ... 40 kPa	25 bar	H7	0 ... 100 PSI	25 bar
F1	0 ... 60 kPa	25 bar	Q1	0 ... 250 PSI	25 bar
F2	0 ... 100 kPa	25 bar	P1	0 ... 300 PSI	25 bar
F3	0 ... 160 kPa	25 bar			
F4	0 ... 250 kPa	25 bar			
F5	0 ... 400 kPa	25 bar			
F6	0 ... 600 kPa	25 bar			

[3] Nominal pressure (PN)

E	10 bar = 1 MPa ≈ 145 PSI	MB ≤ 250 mbar = 25 kPa ≈ 3.63 PSI
G	25 bar = 2.5 MPa ≈ 362 PSI	MB ≥ 400 mbar = 40 kPa ≈ 5.80 PSI

The rated pressure ranges (PN) are linked to the measuring ranges (MB) and cannot be freely combined.

[4] Seal

M	Metal seal
----------	------------

[5.6] Process connection (EN 873)**Material**

01	Inner thread G $\frac{1}{4}$	1.4404
03	Inner thread G $\frac{1}{2}$	
04	Inner thread $\frac{1}{4}$ - 18 NPT	
05	Inner thread $\frac{1}{2}$ - 14 NPT	
11	External thread G $\frac{1}{4}$	
13	External thread G $\frac{1}{2}$	
14	External thread $\frac{1}{4}$ - 18 NPT	
15	External thread $\frac{1}{2}$ - 14 NPT	

[7] Housing**Material**

S	Bayonet ring housing Ø100	1.4404
T	Bayonet ring housing Ø160	
O	Safety housing Ø100	Acc. to EN 837
P	Safety housing Ø160	Acc. to EN 837

[8] Assembly

0	Direct connection (Standard)
R	Pipe mounting
W	Wall mounting

[9] Fluid charging

0	Without fluid filling
3	Without fluid filling; suitable for O ₂ measurements (free of oil and grease)
1	Glycerine Only for units without contacts
4	Paraffin oil Not for units with magnetic spring contacts
5	Silicon oil For units with and without contacts

It is not possible to fill fluids into units with an installed capacitive position encoder.

[10] Special function

0	Without special function
1	Adjustable marker needle
2	Resettable drag needle Measuring range ≥ 60 mbar

[12] Accuracy class	
C	1.0
B	1.6 Standard version

[13] Special aspects	
0	None
L	Increased load change resistance

[15.16] ATEX		
0A	Non-electrical unit (without switch contacts)	II 2G Ex h IIC T4 Gb II 2D Ex h IIIC T95°C Db
1B	Unit with magnetic spring contacts KE##M##0B4H2 Simple electrical operating equipment acc. to DIN EN 60079-11	II 2G Ex h IIC T4 Gb
1C	Unit with inductive contacts KE##I##0C0H2	II 2G Ex h IIC T4 Gb II 2D Ex h IIIC T95°C Db
2D	Unit with capacitive rotation angle trans- ducer KE0905#9	II 2G Ex h IIC T4 Gb

A minimum operating pressure, that only measuring ranges from 100 mbar achieve, is required to activate a contact element.

3.1 Accessories

Order no.	Planned measures
DZ93 00HE##	Three-spindle compensating and shut-off valve
DZ94 00HE##	Four-spindle equalisation and shut-off valve with venting valve

For more details, please see data sheet DZ93-94 at
www.fischermesstechnik.de.

Order no.	Designation	Type
05003090	Galvanically isolated supply isolating amplifier for ATEX applications. <ul style="list-style-type: none"> • 24 V DC, 1 channel Input: 4 ... 20 mA Output: 4 ... 20 mA • The device can be mounted in Zone 2 / Cl.1, Div. 2 and can receive signals from Zones 0, 1 and 2, as well as 20, 21 and 22 including Mining / Class I/II/III, Div. 1, Size A-G. • SIL2/SIL3 according to IEC 61508 	9106B1A
05003091	Pulse isolator for the transmission of signals from NAMUR sensors and mechanical switches from the ATEX area to the safe area. <ul style="list-style-type: none"> • 24 V DC, 1 channel Switching input (NAMUR) Relay output • The device can be used in safe areas and in zone 2 / div. 2 and can accept signals from zone 0, 1, 2, 20, 21, 22 as well as M1 / class I/II/III, div. 1, size A-G. 	9202B2A

Order no.	Designation	Type
05003092	<ul style="list-style-type: none"> • SIL2 according to IEC 61508 <p>Pulse isolator for the transmission of signals from NAMUR sensors and mechanical switches from the ATEX area to the safe area.</p> <ul style="list-style-type: none"> • 24 V DC, 2 channel Switching input(NAMUR) Relay output • The device can be used in safe areas and in zone 2 / div. 2 and can accept signals from zone 0, 1, 2, 20, 21, 22 as well as M1 / class I/II/III, div. 1, size A-G. • SIL2 according to IEC 61508 	9202B2B
05003093	<p>Display / Programming front</p> <p>Communication interface for setting the operating parameters for supply isolating amplifiers and pulse isolators.</p> <ul style="list-style-type: none"> • The device may only be used in safe areas. • Allows saving the configuration of a device type and loading it into other devices of the same type. • Display for process data and status visualization. 	4501

3.2 Information about the document

This document contains all technical data about the device. Great care was taken when compiling the texts and illustrations. nevertheless, errors cannot be ruled out.

Subject to technical amendments.

**FISCHER Mess- und Regeltechnik GmbH**

Bielefelder Str. 37a
D-32107 Bad Salzuflen

Tel. +49 5222 974-0
Fax +49 5222 7170
www.fischermesstechnik.de
info@fischermesstechnik.de