



⟨Ex⟩ II 3D Ex tc IIIB T125 °C Dc

⟨Ex⟩ II 3G Ex nA IIC T4 Gc





# **Data sheet**

# **DE39 ... R/S**

Digital differential pressure transmitter with colour-change LCD

for explosive areas Dust explosion protection zone 22, dry dusts Gas explosion protection zone 2, gases and vapours





# 1 Product and functional description

#### 1.1 Performance features

#### Typical applications

- · Differential pressure measurements in heavily soiled media
- Filter monitoring
- · Simple pump control systems
- · Pump and compressor monitoring

#### Important features

- · 4-digit colour change LCD
- · Selectable operating mode
  - Differential pressure measurement
  - 2-channel relative pressure measurement.
- Selectable pressure unit (bar, mbar, Pa, kPa, MPa, psi, InWc, mmHg)
- · Selectable measured value display
  - Single-line presentation (channel 1 or channel 2)
     The respective other channel can be shown using the button
  - Two-line presentation (both channels)
- · Zero point correction
- · Signal damping
- 2 programmable output signals (current/voltage)
- · Characteristic curve spread (max. 10:1) with freely selectable offset
- Characteristic curve implementation via table (with max. 30 measuring points)
- Full parameter setting and measuring point protocol possible thanks to optionally available transmitter PC interface
- For use in areas at risk of explosion Zone 2 or Zone 22 depending on model

#### 1.2 Intended use

The devices of the series DE39 can be used as display and switching device for measuring differential pressure of gaseous and fluid media. Its sturdy design also allows heavily contaminated media to be used. Always check the medium compatibility [ 7].

#### 1.2.1 Explosion hazard area classification

#### **Dust explosion protection**

Devices with the order code DE39 ## V0 ### KWDL # S#### are suitable as 'Electrical equipment for use in areas with combustible dust', Zone 22 - dry dusts.

Designation as per guideline 2014/34/EU:

⟨Ex⟩ II 3D Ex tc IIIB T125 °C Dc

 $-10 \, ^{\circ}\text{C} \le T_{amb} \le 60 \, ^{\circ}\text{C}$ 



#### **⚠ WARNING**

### Static electricity

The case must be equipped with an earth connection on the side to reduce the surface resistance.

#### Gas explosion protection

Devices with the order code DE39 ## V0 ### KWDM # R#### are suitable as 'Electrical equipment for use in potentially explosive areas, Zone 2 - Gases and vapours.

Designation as per guideline 2014/34/EU:

⟨Ex⟩ II 3G Ex nA IIC T4 Gc

 $-10 \, ^{\circ}\text{C} \le T_{amb} \le 60 \, ^{\circ}\text{C}$ 

#### 1.3 Design and mode of operation

The pressure is measured by two integrated ceramic sensor elements whose measuring signals P+ and P- are analysed by a digital measuring transducer. The analysis allows two independent switching points to be set and makes two programmable output signals available. The measurements can be shown together, separately or alternately. The nominal pressures of the integrated sensors and the differential pressure measuring range are set permanently exworks and stated on the type plate.

The unit works in two operating modes:

#### (a) Differential pressure

In this operating mode, both channels can be independently assigned to the input signals (P+) and (P-). In addition, the differential pressure (dP) or a function (Fct.) can also be assigned as desired. With the function, each output signal can be square rooted or a characteristic curve can be defined by means of a table.

#### (b) 2-channel

In this operating mode, the output (Sig1) is permanently assigned to the pressure (P+) and the output (Sig2) to the pressure (P-). The function is used to square root both output signals or to define a characteristic curve by means of a table.

## 1.4 Function diagram

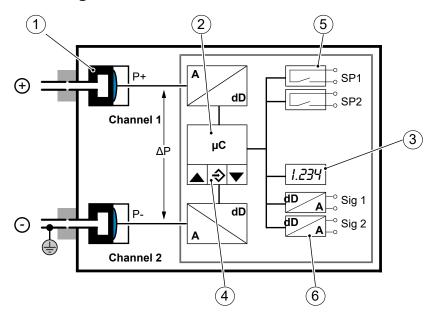


Fig. 1: Function diagram

| 1 | Ceramic sensor element | 2 | Micro-controller |
|---|------------------------|---|------------------|
| 3 | Advertisement          | 4 | Keyboard         |
| 5 | Switching outputs      | 6 | Analogue outputs |

# 1.5 Equipment versions

# Units for Zone 2 Colour change display Nameplate Information sign Wall mounting plate Cutting ring screw connection M12 plug 1 MS nickel-plated ATEX marking Ground connection only for units for Zone 22

Fig. 2: Equipment versions

# 2 Technical data

# 2.1 Input variables

#### **Measuring variable**

Differential and relative pressure

#### **Measuring range**

| Measuri | ng range | Stat. operating pressure max. | Overpres-<br>sure | Bursting pressure |
|---------|----------|-------------------------------|-------------------|-------------------|
| bar     | MPa      | bar                           | bar               | bar               |
| 06      | 00.6     | 6                             | 20                | 35                |
| 010     | 01.0     | 10                            | 40                | 70                |
| 016     | 01.6     | 16                            | 40                | 70                |
| 025     | 02.5     | 25                            | 100               | 150               |
| 040     | 04.0     | 40                            | 100               | 150               |

# 2.2 Output sizes

#### Analogue output signal

Connection type: Three-wire

Max. Spread: 10:1

| Outlet  | Signal range | Apparent ohmic resistance   |
|---------|--------------|---|
| 0 20 mA | 0.0 21.0 mA  | $U_b \le 26 \text{ V} : R_L \le (U_b - 4 \text{ V})/0.02 \text{ A}$ |
| 4 20 mA |              | $U_b > 26 \text{ V} : R_L \le 1100 \Omega$                          |
| 0 10 V  | 0.0 11.0 V   | $R_L \ge 2 k\Omega$   |

#### **Switching outputs**

2 potential-free semiconductor switches (MOSFET)

|                           | MOSFET   |
|---------------------------|--|
| Progr. switching function | One-pin activator (NO) One-pin deactivator (NC)    |
| Max. switching voltage    | 332 V AC/DC  |
| Max. switching current    | 0.25 A   |
| Max. switching output     | $8 \text{ W} / 8 \text{ VA}$ $R_{ON} \le 4 \Omega$ |

# 2.3 Measurement accuracy

| Max             | 0.5 % FS                           |
|-----------------|------------------------------------|
| Typical         | 0.2 % FS                           |
| Max             | 0.5 % FS                           |
| Typical         | 0.2 % FS                           |
| Max             | 1.0 %                              |
| Zero point      | 0.07 % FS/K                        |
| Measuring range | 0.05 % FS/K                        |
|                 | Typical Max Typical Max Zero point |

<sup>1)</sup> incl. non-linearity and hysteresis

#### 2.4 Auxiliary energy

| Rated Voltage             | 24 V AC/DC       |
|---------------------------|------------------|
| Allowed operating voltage | 12 32 V AC/DC    |
| Power input               | approx. 2 W (VA) |

A CE-compliant power supply unit with a 200 mAT fuse only may be used as a power supply.

#### 2.5 Operating conditions

| Increase ambient temperature | -10 +60 °C   |
|------------------------------|--|
| Media temperature            | -10 +60 °C   |
| Storage temperature          | -20 +70 °C   |
| Enclosure protection class   | IP65 as per EN 60529   |
| ATEX                         | EN 60079-0:2012 + A11:2013<br>EN 60079-15:2010<br>EN 60079-31:2014 |
| EMC                          | EN 61326-1:2013<br>EN 61326-2-3:2013                               |
| RoHS                         | EN IEC 63000:2018  |

# 2.6 Display and operating interface

#### **Advertisement**

4...6-digit LCD, full graphic, colour backlighting

#### **Programming**

| Attenuation                            | 0.0 100.0 s (jump response time 10 / 90 %)   |
|--|--|
| Switch output                          | Switch-off point, switch-on point, response time (01800s), function (NC / NO contact), channel assignment                |
| Measuring range unit                   | bar, mbar, Pa, kPa, MPa, psi, InWc, mmWs, mmHg, 'free unit', starting value, end value and decimal point for 'free unit' |
| Output signal                          | User-definable within the basic measuring range (1)  |
| Zero-point window                      | 0⅓ of the basic measuring range (2)  |
| Offset correction                      | ±⅓ of the basic measuring range (3)  |
| Implementation of characteristic curve | linear, square rooted, table with 330 support points   |
| Password                               | 001 999 (000 = no password protection)   |
| Language (can be switched)             | DE, EN, FR, ES, IT, PT, and HU   |

- (1) Max. effective spread 10:1
- (2) measured values around zero are set to zero.
- (3) To compensate different installation positions.

# 2.7 Construction design

#### **Process connection**

| Туре                          | the material.       | Size      |
|-------------------------------|---------------------|-----------|
| Inner thread                  | 1.4404              | G1/8      |
| Cutting ring screw connection | 1.4571              | 6 mm tube |
| Cutting ring screw connection | 1.4571              | 8 mm tube |
| Cutting ring screw connection | Nickel-plated brass | 6 mm tube |
| Cutting ring screw connection | Nickel-plated brass | 8 mm tube |

#### **Materials**

| Housing                   | Polyamide (PA) 6.6  |
|---------------------------|---|
| Media-contacting material | CrNi steel 1.4404, FKM, Rubalit® 708 + Process connection (see above) |

#### **Assembly**

Attachment boreholes on the rear side for attachment to mounting plates.

Wall mounting using wall mounting plate

Panel mounting set for installing the panel

Assembly of the mounting rails using an adapter

#### 2.7.1 Dimensional drawings

#### Wall mounting

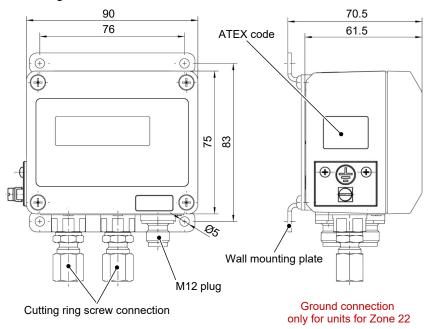


Fig. 3: Dimensional picture

#### Attachment boreholes on rear side


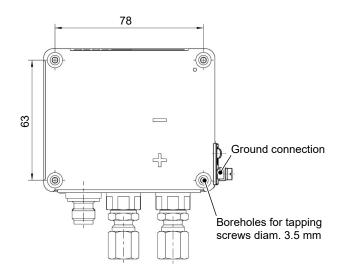


Fig. 4: Rear view of dimensional picture

# 3 Order Codes

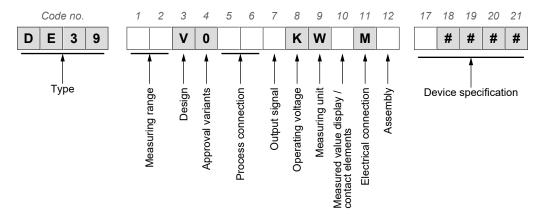

#### Measuring range:

| [1.2] | (Code no.) |
|-------|------------|
| 06    | 06 bar     |
| 07    | 010 bar    |
| 80    | 016 bar    |
| 09    | 025 bar    |
| 10    | 040 bar    |

#### Design:

| [3] | (Code no.)        |
|-----|-------------------|
| R   | CrNi Steel 1.4404 |

#### **Approval variants:**

| [4] | (Code no.) |
|-----|------------|
| 0   | Default    |

#### **Process connection:**

| [5.6] | (Code no.)                                       |               |
|-------|--|---------------|
| 00    | Inner thread G1/8                                |               |
| 24    | Cutting ring screw connection made of 1.4571     | for 6 mm tube |
| 25    | Cutting ring screw connection made of 1.4571     | for 8 mm tube |
| 28    | Cutting ring connection made of brass galvanised | for 6 mm tube |
| 29    | Cutting ring connection made of brass galvanised | for 8 mm tube |

#### Output signal:

| [7] | (Code no.)            |
|-----|-----------------------|
| 0   | without output signal |
| 4   | 0 20 mA               |
| 5   | 0 10 V                |
| 6   | 4 20 mA               |

#### Operating voltage:

| [8] | (Code no.) |
|-----|------------|
| K   | 24 V AC/DC |

## Measuring unit:

| [9] | (Code no.)                |
|-----|---------------------------|
| W   | Selectable pressure units |

# Measured value display / contact elements:

| [10] | (Code no.)                |                          |
|------|---------------------------|--------------------------|
| D    | 4-digit colour change LCD | 2 semiconductor switches |

#### **Electrical connection**

| [11] | (Code no.)                                |         |
|------|---|---------|
| M    | M12 plug connection                       | Zone 2  |
| L    | M12 connector socket Ms-nickel-<br>plated | Zone 22 |

# Assembly:

| [12] | (Code no.)                                   |
|------|--|
| 0    | Attachment boreholes on rear side (standard) |
| W    | Wall mounting                                |

# **Device specification:**

| [17] | (Code no.)   |
|------|--|
| R    | Gas explosion protection zone 2, gases and vapours |
| S    | Dust explosion protection zone 22, dry dusts       |

| [1821] | (Code no.) |
|--------|------------|
| ####   | Ser. No.   |

#### 3.1 Accessories

| Order no. | Designation                                | No. of<br>Poles | length |
|-----------|--|-----------------|--------|
| 06401993  | M12 Connection cable for switching outputs | 4-pin           | 2m     |
| 06401994  | M12 Connection cable for switching outputs | 4-pin           | 5m     |
| 06401563  | M12 Connection cable for switching outputs | 4-pin           | 7m     |
| 06401572  | M12 Connection cable for switching outputs | 4-pin           | 10m    |
| 06401995  | M12 Connection cable for supply/signal     | 5-pin           | 2m     |
| 06401996  | M12 Connection cable for supply/signal     | 5-pin           | 5m     |
| 06401564  | M12 Connection cable for supply/signal     | 5-pin           | 7m     |
| 06401573  | M12 Connection cable for supply/signal     | 5-pin           | 10m    |

#### Remote configuration

| Order no. |  |                 |
|-----------|--|-----------------|
| EU05 0000 | Transmitter PC interface incl. PC software | without battery |
| EU05 0001 | Transmitter PC interface incl. PC software | With battery    |
| EU03 F300 | Transmitter PC interface incl. PC software |                 |

A data sheet is available on our website  $\underline{\text{www.fischermesstechnik.de}}$  or on request.

#### 3.2 Information about the document

This document contains all technical data about the device. Great care was taken when compiling the texts and illustrations. nevertheless, errors cannot be ruled out.

Subject to technical amendments.







FISCHER Mess- und Regeltechnik GmbH

Bielefelder Str. 37a D-32107 Bad Salzuflen

Tel. +49 5222 974-0 Fax +49 5222 7170

www.fischermesstechnik.de info@fischermesstechnik.de